

Audi

Please give copies to
all your Audi Technicians

Technical Bulletin

Subject: Charge Pressure Bypass Valve, Noisy

Group: 21

Number: 00-01

Model(s): TT with 1.8L Turbo
(eng. codes ATC, AMU, AWP)

2000 ►

Date: Dec. 8, 2000

Condition


Groaning or howling noise from engine compartment when accelerating during partial load between 2500-3000 RPM.

Rattling noise when decelerating between 2000 - 3000 RPM.

May be caused by the Internal diaphragm of the Charge pressure bypass valve producing pulsating noises.

SERVICE:

- Road test to verify condition.
- Remove upper engine cover.
- ◀ - Remove Charge pressure bypass valve.
- Install new Charge pressure bypass valve, Part no: 06A 145 710N.
- Install upper engine cover.
- Road test to verify condition has been eliminated.

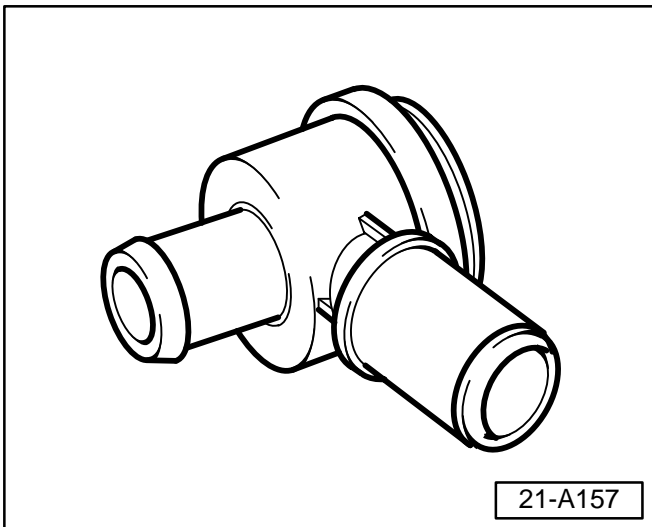

CAUTION!

*Part numbers are for reference only.
Always check with your Parts Dept. for
the latest parts information.*